

## X320 CHECKWEIGHING THROUGH THE FRONT PANEL

1. Enter into the safe setup mode by pressing the “TARE” key and then the “POWER” key. The display will show “SAFE” → “SETUP”. Keep pressing the “ZERO” key until “CHEcli.u” shows up on the display.
2. Press the “TARE” key and the display will show either “ENABLE” or “OFF”. Use the “NET/GROSS” key for the selection. Press the “TARE” key and the display will show “SrC”. This is what type of check weighing is desired, gross, net, or display. Press the “GROSS/NET” key and the last selection will show up on the display. Use the print key to toggle through “GrOSS, diSP, NET”. Once the selection is made press the “FUNCTION” key and the display will go back to “SrC”.
3. Press the “TARE” key and the display will show “OuEr”. Press the “GROSS/NET” key and the display will show “00000Lb” with the left hand digit flashing. The “GROSS/NET” key will select which digit is flashing and the “PRINT” key will increment the flashing digit. Once the over limit is set press the “FUNCTION” key. The display will go back to “OuEr”.
4. Press the “TARE” key and the display will show “UNdEr”. Press the “GROSS/NET” key and the display will show “00000Lb” with the left hand digit flashing. The “GROSS/NET” key will select which digit is flashing and the “PRINT” key will increment the flashing digit. Once the over limit is set press the “FUNCTION” key. The display will go back to “UNdEr”.
5. Press the “ZERO” key and the display will go back to “CHEcli.u”. Keep pressing the “ZERO” key to “-END-“. Press the “FUNCTION” key and the display will show **SAviNG**, reboot and go to the weigh mode.